

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla DATE: 04/01/05

CORNER DESIGNATION: 5N35, L-05, The East Quarter Corner of Section 18.

**PREVIOUS RENEWALS/SURVEYS ETC.:**

Corner originally established by Odell & Lewis, under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post; drove charred stake; dug pits & raised mound, as per instructions.

The corner was declared lost and was re-established by J.W. Kimbrell, in Record of Private Surveys, Survey No. 125. Kimbrell's notes state: "set stone in md of stone for 1/4 sec. cor."

MONUMENT AND ACCESSORIES FOUND: None.

**MONUMENT MARKING DETAIL:**

T5N R35E  
1/4  
S18|S17  
2005  
PLS 1106

**MONUMENT SET:**

I held the South edge of a wire rock basket with fences running North and East and an old down fence South as best remaining evidence of original corner. The corner falls on a bare, rocky hillside. The old post in the wire rock basket is quite old, there are square iron nails driven into it. At the re-established corner point, drove a 5/8" x 15" rebar to bedrock set a 2" aluminum cap on it. The cap is 2" above ground level. Cap marked as shown in Monument Marking Detail.

**New accessories:**

A 5/8" x 24" rebar with a 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372", with cap 1" above ground level bears North, 72.4 feet.

A 5/8" x 24" rebar with a 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372", with cap 1" above ground level bears North 11° East, 99.3 feet.

A 5/8" x 24" rebar with a 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372", with cap 1" above ground level bears North 23° East, 100.7 feet.

A 5/8" x 24" rebar with a 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372", with cap 1" above ground level bears North 30° West, 52.7 feet.

A railroad spike nears N 76°E, 8.32' from corner monument in East-West fence line.

Attached bearing object signs to all rebar accessories. Nailed "witness" sign to fence corner post 3' Northwest of corner monument.

LOCATION AND COMMENTS: Corner is located at the edge of a 3' diameter wire rock basket with fence corner post inside, and fences running North and East, and an old down fence South.

**OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:**

N = 824600.65  
E = 8717320.20


FIRM: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

/5N35L05

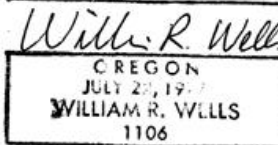

Renews 6/30/06

05-112-c