

OREGON CORNER RESTORATION FORM

Section 8 Township 5N Range 36E
 County Umatilla Date: September 24, 2012

Corner Designation: 5N36J7

Quarter corner common to sections 8 and 17,
 T5N, R36E, W.M., Umatilla County, Oregon.

Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out


Previous Renewals / Surveys, etc.

Corner originally set by Odell and Lewis under contract No. 110 dated February 7, 1865. Their record reads: Set 1/4 Sec. post, drove charred stake, dug pits and raised mound, as per instructions.

Monument and Accessories found: (condition and source)


A basalt stone 13x8x8 burried on end at a fence corner with fences running east and north and a plow line running south.

DIAGRAM

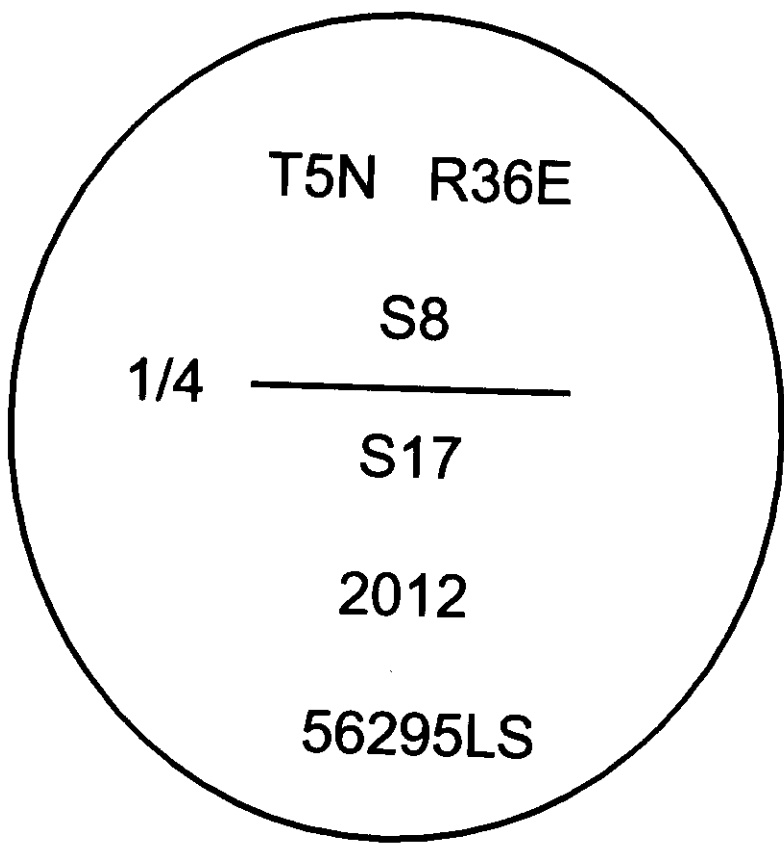

⊙ = Brass Cap
 ● = Rebar Reference

SKETCH

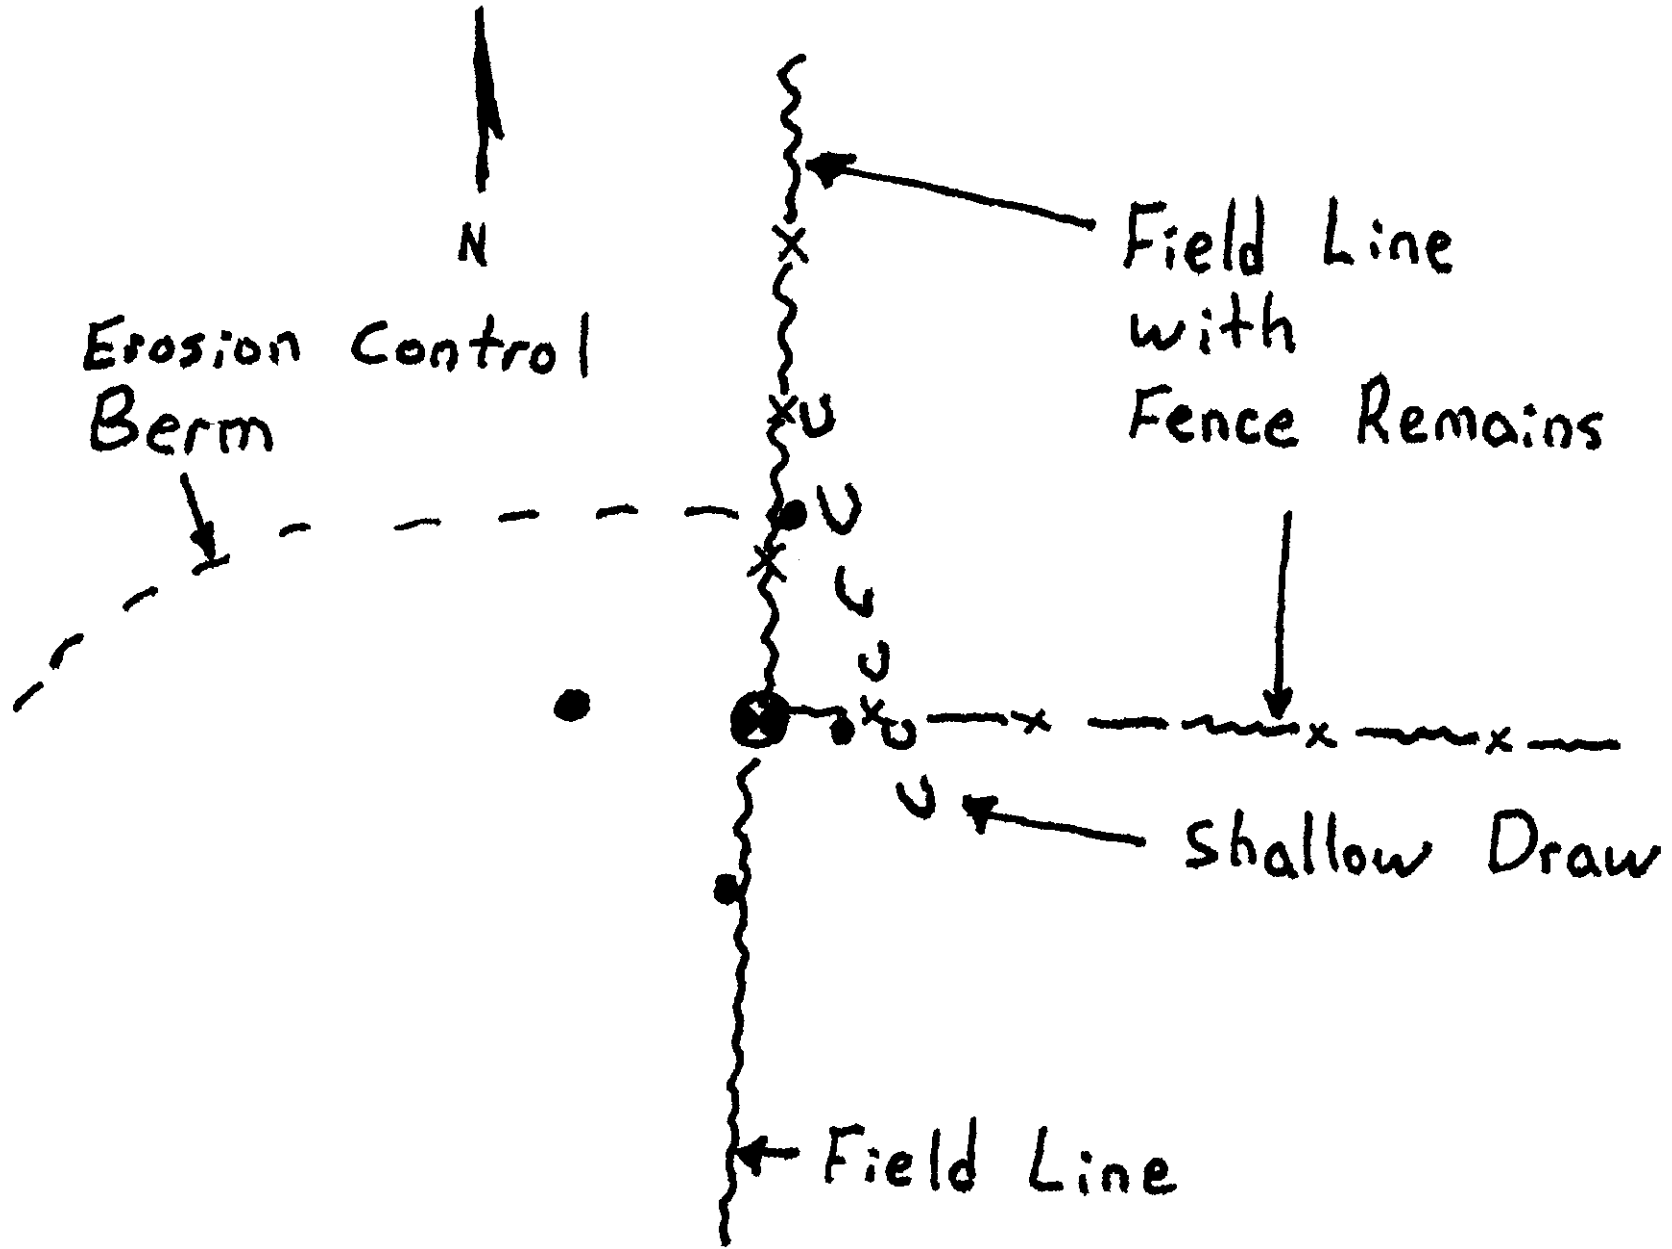

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the position of the stone I set a 2 3/8" brass cap on a 1 1/2" x 30" galvanized iron pipe stamped as shown in the diagram above.

For references, I set four 5/8" by 24" iron rebars with 1 1/4" orange plastic caps stamped WTS and 56295LS as described below 20" below the surface:

- an iron rebar bears S89°37'22"W, 35.89 feet;
- an iron rebar bears N4°14'21"W, 24.07 feet;
- an iron rebar bears S86°19'29"E, 24.68 feet;
- an iron rebar bears S4°45'39"W, 36.00 feet;

The monument and references were tied using a Trimble R7/R8 RTK GPS system.

Location and comments
 NAD 83/1991 State Plane Coordinate
 Oregon North Zone
 N = 828187.64 ift
 E = 8752027.78 ift

Compass Declination

Surveyors Seal

RECEIVED BY:
 Umatilla County Surveyor
 Date: 12/6/2012
 Rec'd By: S. Ous
 No. 12-155-B

Firm / Agency
 Witness Tree Surveying
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K, Haddock

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Stephen K. Haddock

OREGON
 JULY 9, 2001
 STEPHEN K. HADDOCK
 56295LS

RENEWAL DATE 6-30-13