


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-11

**History of original corner establishment:** In 1872, under GLO Contract No. 176, George Williams set a basalt stone 20"x18"x12" for 1/4 cor to secs. 33 & 4 on side hill face N.E.  
 In Aug. 1899 a resurvey of the exterior lines of T5N R38E was done by George R. Campbell and William E. Campbell under GLO Contract No. 699. They could find no evidence of original stone set for 1/4 cor in 1872 and set basalt stone 24x10x10 ins 18 ins in ground for 1/4 cor N. boundary of sec. 4, marked 1/4 on N face, from which a Fir, 24 ins diam bears S70E, 23 lks dist marked 1/4 S4 BT.

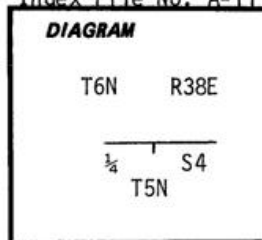

**Description of corner evidence found:** I could find no trace of original stone set in 1872 or 1899. Found dead Fir snag 27" diam with visible scribing "1/4 S BT". At record bearing & dist found 3/4" steel pin next to old blaze line tree with blazes on 4 sides.


**Description of monument and accessories established to perpetuate the**

**original location of this corner:** In place of 3/4" pin set 1"x30" pipe with brasscap 3" diam stamped:

Set pipe 20" in ground with mound of stone to cap.  
 Bearing trees:

Old: A dead White Fir snag 27" dia bears S70E, 15.2 ft with visible "1/4 S BT".

New: A White Fir 14" dia bears S70W, 17.3 ft scribed 1/4 S4 BT.  
 A White Fir 12" dia bears S720E, 27.0 ft scribed 1/4 S4 BT.

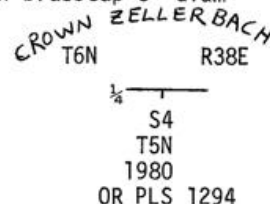

Attached 54-3 & 54-4 signs to all BT's.  
 Attached brass washer stamped LS 1294 to foot blaze of new BT's. Painted blazes & 6" band around all BT's.

I hereby certify the above corner monument was re-established as herein described on Sept. 4, 1980.

Witnesses: R. Orton  
 L. Huntsman



Office of..... County Surveyor..... County of..... Umatilla  
 State of..... Oregon..... I hereby certify that the within instrument was filed in this office  
 for record on the..... day of..... December..... 19..... 80  
 David Krumbein by Betty Stratts  
 (COUNTY OFFICIAL) (DEPUTY)