

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. Z-11

History of original corner establishment:

The original corner was established by George S. Pershin in 1881 under GLO contract No. 361. The record reads: 40.00 set pine post on level for 1/4 sec. cor.

A fir 12 in. diam. brs. N. 5°E. 24 lks dist.

A tamarack 8 in. diam. brs. S. 33 lks dist.

This corner was re-monumented in 1977 by PLS 933. His record reads:

Found old BT on ground, Location could not be found. We did not use it.

Set 2 1/2" x 30" iron pipe 27" in ground with a brass cap marked as shown.

From which I scribed New Bearing Trees.


A 9" fir bears N. 76°49'W 31.0 ft. mkd. 1/4 S.33 SC BT.

A 12" fir bears N. 63°58' E 15.7 ft. mkd. 1/4 S.33 SC BT.

I nailed a brass cap mkd. PLS 933 on BT blaze to both trees. Set a

steel fence post 4 ft. East of corner. Corner is 32 ft. North of

E-W fence line. Used transit and steel tape, measuring to the center of BTs.

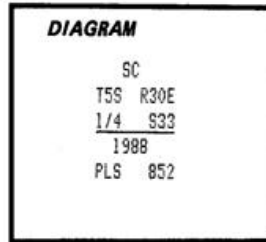

Description of corner evidence found:

The remains of a 12" fir were found pushed up in a slash pile. It was not possible to determine where this tree had been. A 9" White Fir was found dead and down. The location of this tree and the monument set by his crew in 1977 were discussed with PLS 933. We agreed that the corner should be re-established based on new evidence found since his previous survey. There was no evidence of either monument previously set in this heavily damaged clearcut area.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 30" aluminum pipe 26" in the ground at the point on the First Standard Parallel which was one third of the way between the found original southeast corner of section 33 and the found original south one quarter of section 34. Stamped the 2 1/2" aluminum cap as shown in the diagram. Placed a collar of stone around the monument. Set a steel fence post 5' west of the monument and attached a Forest Service Land Survey Monument sign.

New Bearing Trees:

A 9" Douglas Fir bears N86°30'E, 79.2' scribed 1/4 S33 SC BT in a 30" blaze.

A 7" Douglas Fir bears S36°00'E, 72.1' scribed 1/4 S33 SC BT in a 30" blaze.

Nailed an aluminum washer between the letters B and T on each tree. Made a band around each tree. Painted the blazes and the bands red. Attached Forest Service Land Survey Monument and Bearing Tree signs to each tree.

I certify the above corner points were perpetuated and established as hereon described on November 3, 1988.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

David L. Haddock

**OREGON
JULY 12, 1960
DAVID L. HADDOCK
852**

Office of Survey Dept County of Umatilla
 State of OR, I hereby certify that the within instrument was filed in this office
 for record on the 18th day of January, 1989
David H. Plumb by Kathleen Anderson
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
 Umatilla County Surveyors
 Date 1-89
 Rec'd by KA
 No. 89-13-B

☆ GPO-798-276

211