


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in 1880 by George S. Pershin, under Contract No. 361

Surveyor General Record States:

40.00 Set basalt stone 15x10x5 on slight south slope for 1/4 sec. cor.

Fir 10 in. diam. brs N. 51° W. 15 lks. dist.
Fir 24 in. diam. brs S. 8° W. 23 lks. dist.

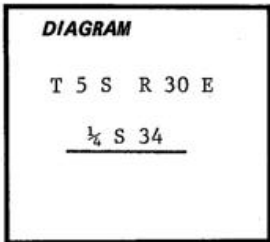

No record of subsequent remonumentation found in County records.

Description of corner evidence found:

Found a basalt stone 12x8x5 dimly marked 1/4. From which the ORIGINAL BEARING TREES:

The remains of an 8" Fir stump bears N. 51° W. 9.9 ft. The blaze marked 1/4 S BT was alongside this stump.

The remains of a completely deteriorated fir brs. S. 8° W. 15.2 feet. This BT was destroyed by construction of old skid road.

Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point: Set a 2 1/2"x30" galvanized iron pipe 22" in the ground with brass cap marked as shown. From which I scribe NEW BEARING TREES:


A 22" pine bears N. 53° E. 48.0 ft. mkd. T5S R30E 1/4 S34 SC BT.
A 16" tamarack bears N. 74° W. 35.1 ft. mkd. T5S R30E 1/4 S34 SC BT.

I nailed a brass washer marked "OPLS 598" to the BT blaze of both trees. Set steel fence post 5 ft. West of corner. Buried original corner stone West and alongside pipe. Raised mound of stone 3 ft. base to top of pipe. Corner is 6 feet North of E-W fenceline and 70 ft. West of a dry creek. Used compass with 20° East variation and steel tape, measuring to the center of the new BTs.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Sept. 30, 1976

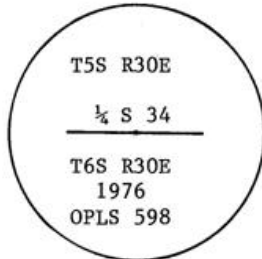

Office of..... County Surveyor..... County of..... Umatilla
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

2-15

I-106R