


V-13

History of original corner establishment:

Original corner established by George S. Pershin in 1881. The original corner point was remonumented by the Bureau of Land Management in 1968 from evidence of the original Pershin survey.

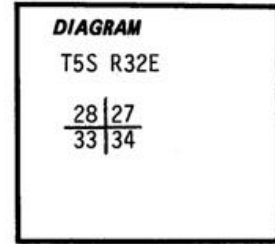

Description of corner evidence found:

Found a 2 1/2" dia. iron pipe, firmly set, in a small mound of stone, with brass cap marked:

From which the remains of the Pershin BT's:

A burnt Larch stump 18 ins. dia., bears N 70°E

23.8 ft. with downed tree alongside, scribing

"T5S R32E S27 BT" visible on unhealed blaze,

An 18" Larch snag with scribing "T5S R32E S34 BT:

visible on an unhealed blaze, bears S 28°E 50.8 ft.,

A 25" Ponderosa Pine windfall, with scribing "R32E S33" visible on an unhealed blaze bears S22°W 48.2 ft.

A decayed Fir stump, size indeterminate, no marks visible, bears N20°W 22.4 ft.

And the BLM bearing trees:

A 10" Lodgepole Pine (Larch per BLM record) alive with scribing visible on partially healed blaze, bears N52°E 60.1 ft. (CONTINUED ON PAGE 2)

U.S. Dept. of Interior
Bureau of Land Management
T5S R32E

S28 | S27
S33 | S34
1968

Description of monument and accessories established to perpetuate the original location of this corner:

We mark new BT's in the SE and SW quadrants:

An 8" Douglas Fir, scribed "T5S R32E S34 BT" on a double blaze bears S 59°E 49.6 ft.

And a 12" Douglas Fir, scribed "T5S R32E S33 BT" on a double blaze bears S 8°W 61.6 ft.

Attached brass washer miked "LS 1099 to lower blaze of new BT's
Corner is located approx. 5 ft. south of an E-W fence.

Magnetic Compass (20° East Declination)
Steel Tape

August 21, 1984

Witnesses:

Gary Langlitz, LS 1099
Ray Crapo
Greg Orton




Office of Surveyor County of Umatilla
 State of Oregon I hereby certify that the within instrument was filed in this office
 for record on the October day of 1984
David Krueger by Billy Cochran
 (COUNTY OFFICIAL) (DEPUTY)

84-137-R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

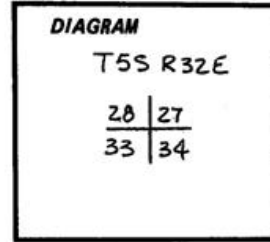

Description of corner evidence found:

An 8" White Fir snag, well-healed, bears S 28 1/2°E 46.5 ft.
 A 6" Douglas Fir snag, well-healed bears S 28°W 7.6 ft.
 And a 10" Douglas Fir, alive with scribing visible on partially
 healed blaze bears N 17°W 26.7 ft. (BLM record N44°W).

Description of monument and accessories I established to perpetuate the original location of this corner:

Office of..... County of.....
 State of..... I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

V-13

84-132d