


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner position determined by Bureau of Land Management during survey performed between 1968-1980, Set an iron post, 28 ins. long, 2 1/2 ins. diam., 14 ins. in the ground to solid rock, in a mound of stone 3 ft. base to top, with brass cap marked:

from which:
A Pine, 13 ins. diam. bears S 47°E
136 1/2 lks. dist., mkd. CW 1/16 S 32 BT.

W 1/16
C ——— C
S 32
1980

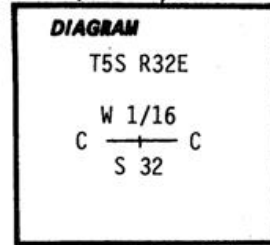

No other suitable trees available within limits.
Raise a mound of stone, 3 ft. base, 1 1/2 ft. high, N of corner.

Description of corner evidence found:

Found a 2 1/2" dia. iron pipe, firmly set in a mound of stone, with brass cap marked as described in the BLM record, from which:

The BT marked by BLM:
A 14" Ponderosa Pine, alive with scribing visible on partially healed blaze, bears S 47°E 90.1 ft.
And a mound of stone, 3 ft. base and 1 1/2 ft. high is located approx. 5 ft. N of the corner.

Description of monument and accessories I established to perpetuate the original location of this corner:

We mark an additional BT:
A 6" Ponderosa Pine, scribed "CW 1/16 S 32 BT" on a double blaze, bears S 10°W 94.6 ft., attached brass washer marked "LS 1099" to lower blaze.

Corner is located 6 ft. West of a N-S fence.

August 30, 1984

Magnetic Compass
(20° East Declination)
Steel Tape

Witnesses:
Gary Langlitz, LS 1099
Ray Crapo
Greg Orton



Office of Surveyor County of Umatilla
State of Oregon hereby certify that the within instrument was filed in this office
for record on the October day of 1984
David Krumbein by Betty Cochran
(COUNTY OFFICIAL) (DEPUTY)

X-6
84-139-R