

**OREGON CORNER RESTORATION FORM**

COUNTY: Umatilla. DATE: 04/10/08

CORNER DESIGNATION: P-21, The East One-Quarter Corner of Section 23, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post. Drove charred stake; dug pits & raised mound, as per instructions.

MONUMENT AND ACCESSORIES FOUND: Held old locust post in East-West field and berm line. Bartleson, in Survey No. 99-282-B, calculated a position for this corner did not use the locust post and old field line evidence.

**MONUMENT MARKING DETAIL:**

T6N R36E  
1/4  
S23 | S24  
2008  
PLS 1106

MONUMENT SET: Held old locust post as best remaining evidence of the original corner. At a point just East of old locust post, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, 28" in the ground, marked as shown in "Monument Marking Detail".

**New accessories:**

- A silver deep-1 magnet in E-W field line bears South 82° East, 32.9 feet.
- A purple deep-1 magnet bears South 40° East, 29.0 feet.
- A blue deep-1 magnet bears South 51° West, 27.3 feet.
- An orange deep-1 magnet in field line extending West bears North 86° West, 35.3 feet.
- Deep-1 magnets are buried 20" below ground surface with bearing object signs. Nailed witness sign to the locust post

LOCATION AND COMMENTS: Corner is just East of an old locust fence corner post, in a East-West field line. There are fence remains in this East-West field line further East.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 852692.03  
E = 8769592.02


FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Surveyor's Seal

Witnesses: Jason Wells, LSIT

\6N36P21

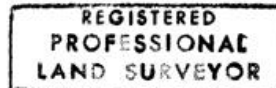

*William R. Wells*

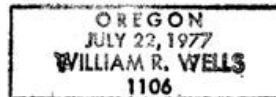

*renews 6-30-10*