

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla **DATE:** 06/12/2014

CORNER DESIGNATION: L-21, Quarter Corner Section for Sections 14 and 13, Township 6 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:


Originally surveyed by A.H. Simmons for Deputy Surveyor George Williams under his contract No. 176 dated October 23, 1872; his notes state "Set post for ¼ Sec. Cor., from which:
A White fir 10 in. dia., bears N 80° E., 14 lks. dist.
A Red fir 9 in. dia., bears N 65° E., 16 lks. dist.

BLM Cadastral Surveyor C. Alfred White in his April 21, 1965 Survey for Group 572, Oregon, states in his notes: "The ¼ sec. cor. of secs. 13 and 14, determined at record bearing and distance from the remains of the original bearing tree:

A fallen and decayed fir 13 ins. diam., bears N. 65° E., 16 lks. dist., with a decayed blaze. No marks remain.

At the corner point

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground with a brass cap mkd.

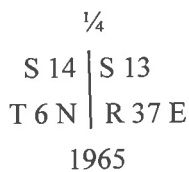

from which new bearing trees.

A fir 7 ins. diam., bears S. 71° E., 58 lks. dist., mkd. ¼ S13 BT.

A fir 10 ins. diam., bears S. 25½° W., 34 lks. dist., mkd. ¼ S14 BT.

MOUNUMENT AND ACCESSORIES FOUND:

Found 3½ in. BLM brass cap on a 2½ in. iron pipe, +/- .2' from ground as noted by the 1965 BLM Survey.

Found 20" diam. Fir with healed blaze and bearing sign, bears S 71° E., 38.30 ft.

MOUNUMENT MARKING DETAIL:



MOUNUMENT AND ACCESSORIES SET:

A White fir 22 ins. diam., bears N 52° W., 7.15 ft. dist., blazed, scribed, tagged and painted. Mkd. "T6N R37E ¼ S14 BT"

A Tamarack 14 ins. diam., bears S 34° E., 89.10 ft. dist., blazed, scribed, tagged and painted. Mkd. "T6N R37E ¼ S13 BT"

A Ponderosa Pine 28 ins. diam., bears N 26° E., 50.85 ft. dist., blazed, scribed, tagged and painted. Mkd. "T6N R37E ¼ S13 BT"

A "T" post with witness sign is 1 ft. north of monument.

LOCATION AND COMMENTS:

Quarter Corner is located on a North-South barbed wire fence line +/- 350 ft. south of fence corner. Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 858912.49

E = 8800921.13


COMPASS DECLINATION: 15° East

SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Thomas J. Boshart
Felipe G. Hernandez

REGISTERED
PROFESSIONAL
LAND SURVEYOR

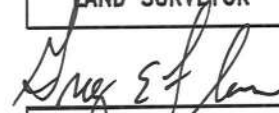

OREGON
JUNE 30, 1997
GREG E. FLOWERS
02820LS

RENEWS 12/31/15

6/29/2015