

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 850413.43

E = 8780308.77

COMPASS DECLINATION: 15° East

SURVEYORS' SEAL:

FIRM: HDJ Design Group

5 N. Colville, Suite 200


Walla Walla WA 99362

WITNESSES: Thomas J. Boshart

Felipe G. Hernandez



Greg E. Flowers

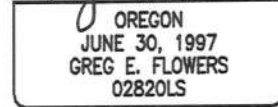

RENEWS 12/31/15

06/29/2015

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla **DATE:** 6/26/2014

CORNER DESIGNATION: R-5, Section Corner common to Sections 19, 20, 29 and 30
Township 6 North, Range 37 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by George Williams, Contract No. 176, dated July 20, 1872. His notes state
"Set stone 8 x 10 x 15, in mound and pits for the cor. of Secs 19, 20, 30 and 29."

Surveyor Paul W.P. Tomkins noted in his April 9, 2001 survey, shown on Umatilla County
Survey record of surveys 01-64-B, "Found 8" x 8" x 10" stone, firmly planted 1 ft. south of
ancient fence corner, S.W. Corner Section 20."

Surveyor Paul W.P. Tomkins noted in his January 8, 2005 survey, shown on Umatilla County
Survey Record of Plats 2005-02, "Found 8" x 8" x 10" stone, firmly planted 1 ft. south of
ancient fence corner, S.W. Corner Section 20, per Survey 01-64-B."

Surveyor Paul W.P. Tomkins noted in his October 14, 2008 survey, shown on Umatilla County
Survey Record of Plats 2008-29, "8" x 8" x 8" stone, 1 ft. south of fence corner, Sec 12, per
Survey 01-64-B."

MOUNUMENT AND ACCESSORIES FOUND:

Found 5" x 8" x 18" stone, firmly planted, 1 foot south of old E-W fence line. There is remnants
of wire going north, most likely this was an old intersection in the fence.

MOUNUMENT MARKING DETAIL:

T6N R37E
S19|S20
S30|S29
2014
LS 02820

MOUNUMENT AND ACCESSORIES SET:

At the position of the found stone, set 1½" x 30" galvanized iron pipe with 2½" brass cap
stamped T6N R37E S19 S20 S30 S29 2014 LS 02820, set the found stone alongside as a witness,
from which set:

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears N52°E, 14.64 feet distance, +/-
7.10 feet north of fence.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears N50°W, 14.68 feet distance,
8.8 feet north of fence.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears S62°E, 11.11 feet distance, +/-
7.50 feet south of fence.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears S82°W, 24.95 feet distance, +/-
4.50 feet south of fence.

LOCATION AND COMMENTS:

Corner is on a moderate south facing grassy slope. Corner is at the top of the east side of a small
runoff ravine running up and down the slope. Bearings taken with Silva hand compass and
distances measured with a steel tape.